

Missing Assembly Notice & Instructions OPW Edge Double Wall Spill Container


IMPORTANT:

This OPW Edge DW Spill Container was shipped without the Visigauge assembly due to a shortage from our vendor. The product was produced with a temporary plug cap in its place to allow the factory and the installer to perform the interstitial test to verify the integrity of the containment.

We apologize for the inconvenience and OPW will send out a replacement Visigauge to the distributor who purchased this product. It will include a Visigauge assembly and one replacement o-ring seal.

Once you have received the Visigauge, please follow these instructions to install it.

- **Step 1**: First, identify the temporary plug cap as the part with the hexagonal shaped head that is installed at the top of the round white gauge riser.
- **Step 2:** Please unthread the temporary plug cap from the round white gauge riser.
- Step 3: Next, install the replacement O-ring onto the underside seat of the Visigauge as shown below.
- **Step 4**: Finally, thread on the Visigauge into the white gauge adapter. This should be tightened to a quarter turn past finger tight.
- Step 5: The Visigauge is now installed and the spill container can be vacuum tested to verify tightness.

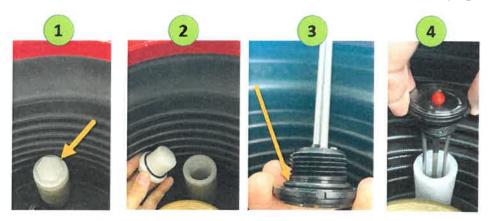

NOTE; Spill Containers with this plug installed will be identified with the below label beside the OPW part # label on the outside of the box.

TEMPORARY PLUG INSTALLED
REPLACE WITH FLOAT WHEN AVAILABLE

CONTACT CUSTOMER SERVICE

10:22 FOR MORE INFORMATION
0 7 / 2 3 / 2 1





OPW Retail Fueling

3250 US 70 Business West Smithfield, NC 27577 Customer Service:1-(800) 422-2525 Technical Service and Questions: 1-(877) OPW-TECH www.opwglobal.com Issue Date: 07-23-2021